Rotating MachinesBulletin




SR0861X, SR0860X: Not dead out of the box!

Owners of 2013 BMW 320i vehicles may occasionally experience the following conditions:

- ▶ The engine does not start
- ► The engine stops running
- ▶ The air conditioning compressor does not turn on
- ► Reverse lights do not work
- ▶ The transmission does not shift into gear
- ▶ Various chassis and engine check control messages

All of these conditions may be caused by a loose ground connection at point Z6000*4B on the engine block near the starter.

To correct this condition, check and tighten the ground point Z6000*4B to 8 Nm. Then Clear all fault codes that might have been stored if the ground was found to be loose.

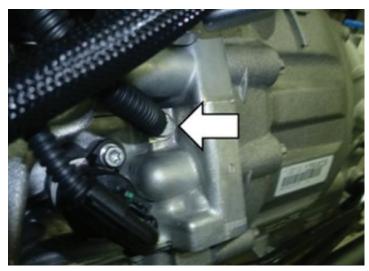

Note the location of the potentially loose cannon ground connection on the engine block near the starter.